

Work Order ID 85988

June-19-12 1:16:33 PM

85988

Page 1

Item ID: D412-664-203TRN

Accept

N900040100

Setup Start

NS1

Revision ID:

Item Name: Crosstube Turning Detail

Stop

NS2

Start Date: 19/06/2012 Start Qty: -1.00

1

Cust Item ID:

Required Date: 03/07/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan: MLJ

Date: 12/06/19

Tooling:

Date:

Run

Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr

Revision Nbr

D412-664-243

Rev E(DEO)

100

0.00

100

MORI SEIKI CNC LATHE LARGE

Mori Seiki

Memo

0.00

Mori Seiki CNC Lathe Large

1-Fill tube with sand & install plugs DT8534 on both ends as per Folio FA166

2-Turn first side as per Folio FA166

3- File transition lines smooth.

FOLIO REV: AM

DWG REV: E

1 Ø

mm.L
12/07/14

110

QC1- Inspect dimensions to dimension sheet

0.00

110

QC

Memo

0.00

Quality Control

1 Ø

mm.L
12/07/14

Work Order ID 85988***85988***

Page 2

Item ID: D412-664-203TRN

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Turning Detail

Start Date: 19/06/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 03/07/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

120

0.00

120

MORI SEIKI CNC LATHE LARGE

Mori Seiki

Memo

0.00

Mori Seiki CNC Lathe Large

1-Turn second side as per Folio FA166
2- File transition lines smooth.
3- Remove sand and plugs
4-Scribe part # and batch # using vibrating stilus
FOLIO REV: AA
DWG REV: E

130

0.00

130

QC1- Inspect dimensions to dimension sheet

QC

Memo

0.00

Quality Control

+ PERFORM ULTRA SONIC MEASUREMENT

140

0.00

140

QC8- Inspect parts - second check

QC

Memo

0.00

Quality Control

+ CHECK ULTRA SONIC MEASUREMENT AND ORIENTATION FOR
BENDING

mm.l
12/07/15mm.l
12/07/15

DP 12-7-16

80
50

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Supplier <input type="checkbox"/>		Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Other <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Supplier <input type="checkbox"/>																
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Other <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Offset/Setup									
Other									
Process									
Supplier									
Training									
Unauthorized									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending Passes Below Min <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimp at Bending <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Other <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Ripples on Inner Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	Hardware <input type="checkbox"/> Breaking <input type="checkbox"/> Missing <input type="checkbox"/> Size/Length <input type="checkbox"/> Spinning <input type="checkbox"/> Threading <input type="checkbox"/> Wrong Drill Holes <input type="checkbox"/> Misaligned <input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Undersized <input type="checkbox"/> Too Many	General <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Documentation/Data <input type="checkbox"/> Finish <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Inspection Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Jigs/Fixtures/Tooling <input type="checkbox"/> Kit Incorrect <input type="checkbox"/> Kit Missing	<input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Off-Set <input type="checkbox"/> Orientation Misread <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Lost <input type="checkbox"/> Part Moved <input type="checkbox"/> Raw Material <input type="checkbox"/> Set-up <input type="checkbox"/> Supplier <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other _____ _____ _____
---	--	---	--

Work Order ID 85988

85988

Page 3

June-19-12 1:16:33 PM

Item ID: D412-664-203TRN

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Item Name: Crosstube Turning Detail

Stop ***NS2***

Start Date: 19/06/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 03/07/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

145

0.00

145

Crosstubes

Memo

0.00

Crosstubes

GRIND ONLY TRANSITION LINES SMOOTH LONGITUDE WAY.

Rm 12-7-19

150

Crosstubes Chemical Conversion

0.00

150

HandFXtube

Memo

0.00

Hand Finishing Crosstubes

*1- Pressure used
2- Acid Etch.
12-07-20*

Rm 12-7-20

160

QC7-Inspect Chemical Conversion Coat

0.00

160

QC

Memo

0.00

Quality Control

D412-664-203TRN

12-7-23

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td style="width: 25%;">Skid-tube <input type="checkbox"/></td> <td style="width: 25%;">Crosstube <input type="checkbox"/></td> <td style="width: 25%;">Prod. Eng. Coord. <input type="checkbox"/></td> <td style="width: 25%;">Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Supplier <input type="checkbox"/>		Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Other <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Supplier <input type="checkbox"/>																
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Other <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data <input type="checkbox"/>									
Equip/Tooling <input type="checkbox"/>									
Operator <input type="checkbox"/>									
Material <input type="checkbox"/>									
Offset/Setup <input type="checkbox"/>									
Other <input type="checkbox"/>									
Process <input type="checkbox"/>									
Supplier <input type="checkbox"/>									
Training <input type="checkbox"/>									
Unauthorized <input type="checkbox"/>									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending Passes Below Min <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimp at Bending <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Other <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Ripples on Inner Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	Hardware <input type="checkbox"/> Breaking <input type="checkbox"/> Missing <input type="checkbox"/> Size/Length <input type="checkbox"/> Spinning <input type="checkbox"/> Threading <input type="checkbox"/> Wrong Drill Holes <input type="checkbox"/> Misaligned <input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Undersized <input type="checkbox"/> Too Many	General <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Documentation/Data <input type="checkbox"/> Finish <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Inspection Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Jigs/Fixtures/Tooling <input type="checkbox"/> Kit Incorrect <input type="checkbox"/> Kit Missing	<input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Off-Set <input type="checkbox"/> Orientation Misread <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Lost <input type="checkbox"/> Part Moved <input type="checkbox"/> Raw Material <input type="checkbox"/> Set-up <input type="checkbox"/> Supplier <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
---	--	---	---

Work Order ID 85988***85988***

Page 4

June-19-12 1:16:33 PM

Item ID: D412-664-203TRN

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Turning Detail

Start Date: 19/06/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 03/07/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run HoursTool ID Tool # Plan Accept Reject Reject Insp.
Code Qty Qty Number Stamp

170

0.00

170

Packaging

Packaging

Memo

0.00

Packaging

Identify and stock in kanban rack
Location: LG

MO 12-723

180

0.00

180

QC21- Final Inspection - Work Order Release

QC

Memo

0.00

Quality Control

12/7/23

ME
12-07-23

Picklist Print

June-19-12 1:16:39 PM

Page 1

Work Order ID: 85988

85988

Parent Item: D412-664-203TRN

D412-664-203TRN

Parent Item Name: Crosstube Turning Detail

Start Date: 19/06/2012

Required Date: 03/07/2012

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:A 08-03-06 new issue DD verified by:eec
IPP Rev B 08.04.02 Removed polish EC verified by: DD

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D6009-129		Manufactured	No			120	Each	19.0000	1	1			

D6009-129

**

Crosstube Material

Location

Loc Qty

Loc Code

LG

19

69801

19

1 12/07/12

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width:100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Supplier <input type="checkbox"/>		Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Other <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Supplier <input type="checkbox"/>																
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Other <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data <input type="checkbox"/>									
Equip/Tooling <input type="checkbox"/>									
Operator <input type="checkbox"/>									
Material <input type="checkbox"/>									
Offset/Setup <input type="checkbox"/>									
Other <input type="checkbox"/>									
Process <input type="checkbox"/>									
Supplier <input type="checkbox"/>									
Training <input type="checkbox"/>									
Unauthorized <input type="checkbox"/>									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending Passes Below Min <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimp at Bending <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Other <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Ripples on Inner Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	Hardware <input type="checkbox"/> Breaking <input type="checkbox"/> Missing <input type="checkbox"/> Size/Length <input type="checkbox"/> Spinning <input type="checkbox"/> Threading <input type="checkbox"/> Wrong Drill Holes <input type="checkbox"/> Misaligned <input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Undersized <input type="checkbox"/> Too Many	General <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Documentation/Data <input type="checkbox"/> Finish <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Inspection Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Jigs/Fixtures/Tooling <input type="checkbox"/> Kit Incorrect <input type="checkbox"/> Kit Missing	<input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Off-Set <input type="checkbox"/> Orientation Misread <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Lost <input type="checkbox"/> Part Moved <input type="checkbox"/> Raw Material <input type="checkbox"/> Set-up <input type="checkbox"/> Supplier <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other _____ _____ _____
---	--	---	--


DART AEROSPACE LTD	Work Order:	85988
Description: Crosstube Assembly (412 High Aft)	Part Number:	D412-664-243
Inspection Dwg: D412-664-243 Rev: E		Page 1 of 2

FIRST ARTICLE INSPECTION CHECKLIST

	Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.684	+0.005/-0.000	2.686	/		vern	CNC-08
	2.748	+0.005/-0.000	2.752	/			
	2.884	+0.005/-0.000	2.884	/			
	3.019	+0.005/-0.000	3.024	/			
	3.163	+0.005/-0.000	3.166	/			
	3.308	+0.005/-0.000	3.312	/			
	3.429	+0.005/-0.000	3.436	/			
	2.990	+0.005/-0.000	2.992	/			
	2.618	+0.005/-0.000	2.621	/		↓	
	0.200	+/-0.010	.200	/		vern	CNC-08
	R0.063	+/-0.010	.063	/		RG	
	R0.500	+/-0.010	.500	/		"	
	4.971	+/-0.030	4.971	/		vern	CNC-08
SIDE B	2.684	+0.005/-0.000	2.686			vern	CNC-08
	2.748	+0.005/-0.000	2.752	/			
	2.884	+0.005/-0.000	2.884	/			
	3.019	+0.005/-0.000	3.024	/			
	3.163	+0.005/-0.000	3.167	/			
	3.308	+0.005/-0.000	3.312	/			
	3.429	+0.005/-0.000	3.431	/			
	2.990	+0.005/-0.000	2.993	/			
	2.618	+0.005/-0.000	2.622	/		↓	
	0.200	+/-0.010	.200	/		vern	CNC-08
	R0.063	+/-0.010	.063	/		RG	
	R0.500	+/-0.010	.500	/		"	
	4.971	+/-0.030	4.971	/		vern	CNC-08
	124.100	+/-0.020	124.100	/		tape	LG-22

DART AEROSPACE LTD		Work Order:	85988
Description: Crosstube Assembly (412 High Aft)		Part Number:	D412-664-243
Inspection Dwg: D412-664-243 Rev: E		Page 2 of 2	

WALL THICKNESS MEASUREMENT

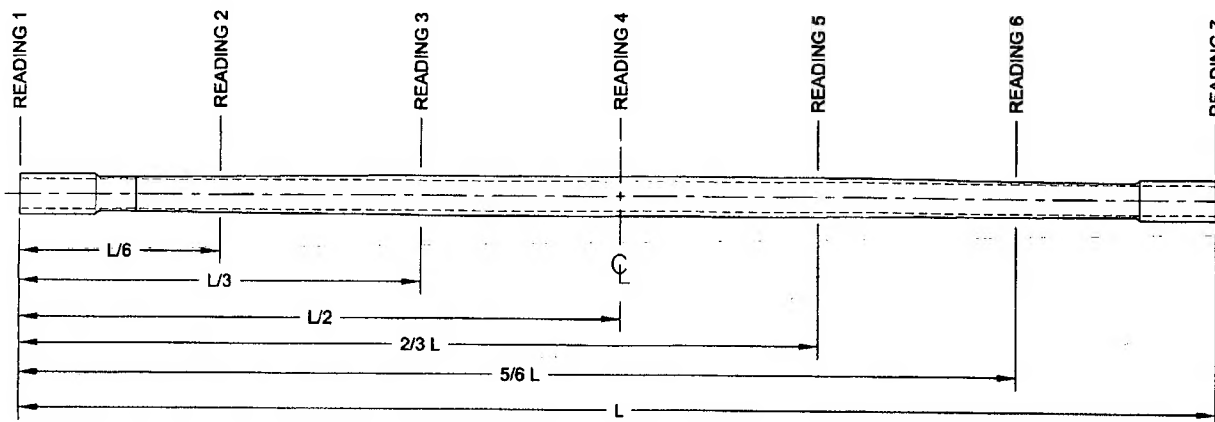

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation Δw (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L=0"	364	363	386	386	.023	0.073"
READING 2 L=19	296	281	307	315	.034	
READING 3 L=39	460	442	466	478	.036	
READING 4 L=62	626	622	637	641	.019	
READING 5 L=89	461	456	466	467	.011	
READING 6 L=19	294	301	307	301	.013	
READING 7 L=CUFF	369	366	379	382	.016	

Calibration Result

Actual Block Thickness: _____

Sitiescan 250 Measured Thickness: _____

Measured by:	mgul
Date:	12/07/16

Audited by:	[Signature]
Date:	12-7-16

Preliminary Approval:	
Date:	

Rev	Date	Change	Revised by	Approved
A	04.06.16	New Issue (P/O D412-664-203)	KJ/JLM	
B	06.03.09	Dwg Rev updated	KJ/JLM	
C	07.05.08	Tolerance updated for dimension 4.971	KJ/JLM	
D	10.02.02	Dimension 124.100 was 124.09	KJ	
E	12.06.04	Wall thickness form added	KJ	[Signature]

Item	Qty -243	Part Number	Description
1	X	D412-664-243	CROSSTUBE ASSEMBLY (412 HIGH AFT)
2	1	D6009-129	CROSSTUBE
3	2	D3595-063-570	RUBBER CUSHION
4	1	D2896-1	SUPPORT
5	2	D3189-1	CHAFING SHIELD
6	2	D2856-600-1009	ABRASION STRIP
7	4	MS21920-28	CLAMP
8	2	MS21920-30	CLAMP (OR MS21920-32)
9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)

GENERAL NOTES:

- MATERIAL: MANUFACTURED FROM D6009-129
FINISHED LENGTH = 124.100±0.020 (BEFORE BENDING/TRIMMING)
- FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- UNITS: INCHES UNLESS OTHERWISE NOTED.
- BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- IDENTIFICATION: SCRIBE DART PART NUMBER "D412-664-243" AND BATCH NUMBER ON INSIDE OF CUFF USING VIBRATING STYLUS.
- WEIGHT: 47.0 lbs (PER IIN-D212-664)
- PART IS SYMMETRIC ABOUT CENTERLINE.
- RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- BEND PROGRESSIVELY WITH A MINIMUM OF 8 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- INSTALL D2896-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2896-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- INSTALL MS21920-30 CLAMPS (OR -32) WITH D3595-063-570 RUBBER CUSHIONS TO SECURE THE D2896-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE OF CROSSTUBE SUPPORT
- INSTALL D2856-600-1009 ABRASION STRIPS WITH A 0.13 REF GAP ON BOTTOM SIDE OF CROSSTUBE PER QSI 035
- EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1 5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.


SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 85988 MLJ

12/06/19


② DEO ATTACHED

RELEASED
2009-10-29


E	REFORMAT/REVISE GENERAL NOTES; REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS; RELOCATED FLAG #6 PER PAR 08-046 (ZN A6-3); ADD TOLERANCE (ZN B6-3, C4-3, C8-3 & C5-3); MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4.	RF	09.09.30
D	REMOVE D2732-058, CHANGE TO D3595-063-570	PH	07.03.09
C	REMOVE D2856-600-1087, ADD D2732-058 & MAGNOBOND 6398, MS21920-32 WAS MS21920-30	MB	06.10.27
B	ADD HOLES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	PH	05.02.04
A	NEW ISSUE	PH	01.10.17
REV	DESCRIPTION	BY	DATE
DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	PH	DRAWING NO.	REV. E
MFG. APPR.	PH	D412-664-243	SHEET 1 OF 4
APPROVED	PH	TITLE	SCALE
DE APPR.	PH	CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	09.09.30	COPYRIGHT © 2001 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR LOANED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD	

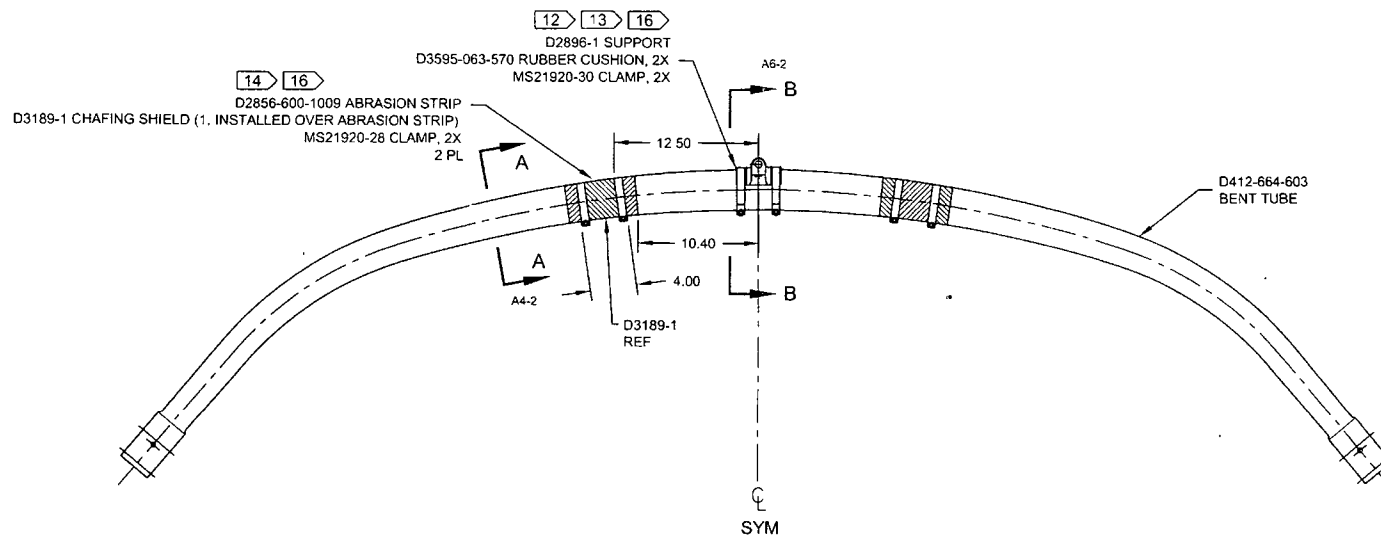

D212-664-243
ASSEMBLY DETAIL

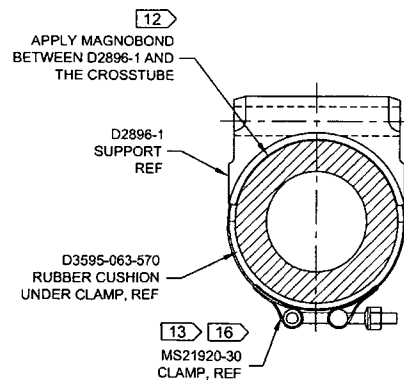

SECTION B-B D4-2
SCALE 4X

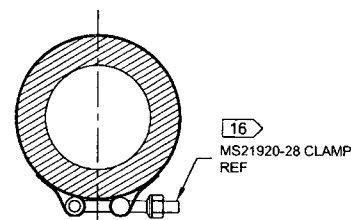

SECTION A-A C6-2
SCALE 4X


DEO ATTACHED

RELEASED
2009-10-28
NRP



DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	9	DRAWING NO.	REV. E
MFG. APPR.	18	D412-664-243	SHEET 2 OF 4
APPROVED	18	TITLE	SCALE
DE APPR.	18	CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	09.09.30	<small>COPYRIGHT © 2001 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

8 7 6 5 4 3 2 1

05988

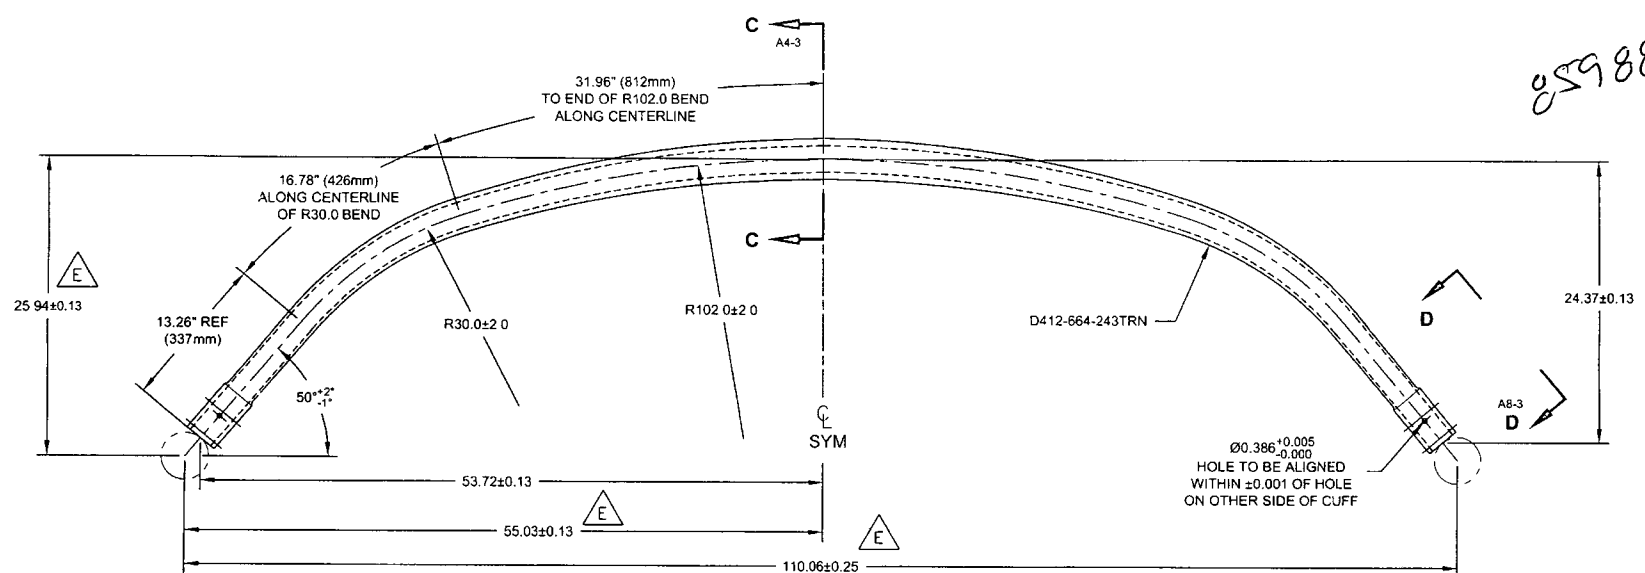



D412-664-603 10
BENDING AND DRILLING DETAIL E

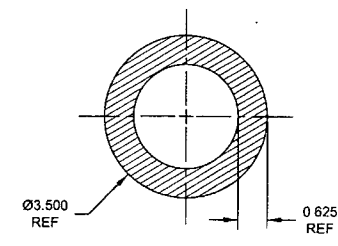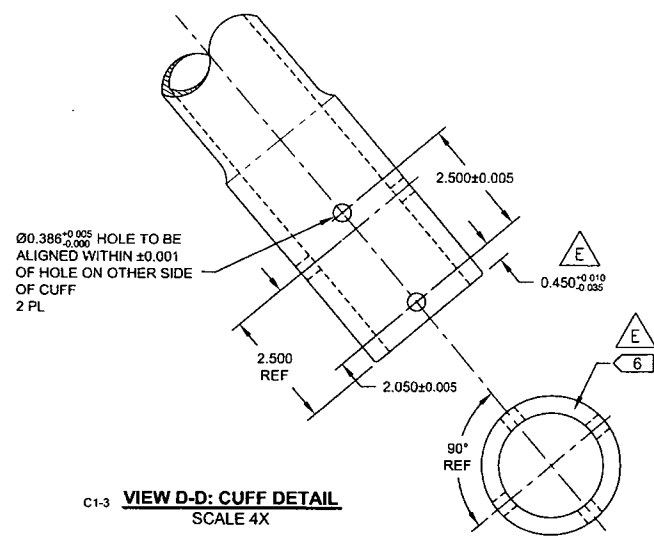

DEO ATTACHED
RELEASED
 2009-10-29
 MP


DESIGN .	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	Q	DRAWING NO.	REV. E
MFG. APPR.	SS	D412-664-243	SHEET 3 OF 4
APPROVED	AP	TITLE	SCALE
DE APPR.	W	CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	09.09.30	COPYRIGHT © 2001 BY DART AEROSPACE LTD <small>THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

8 7 6 5 4 3 2 1

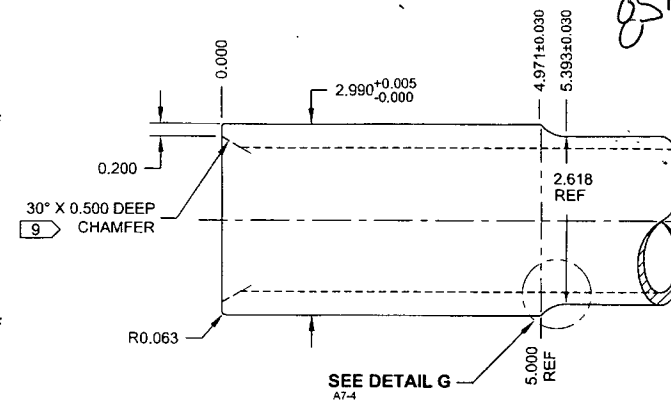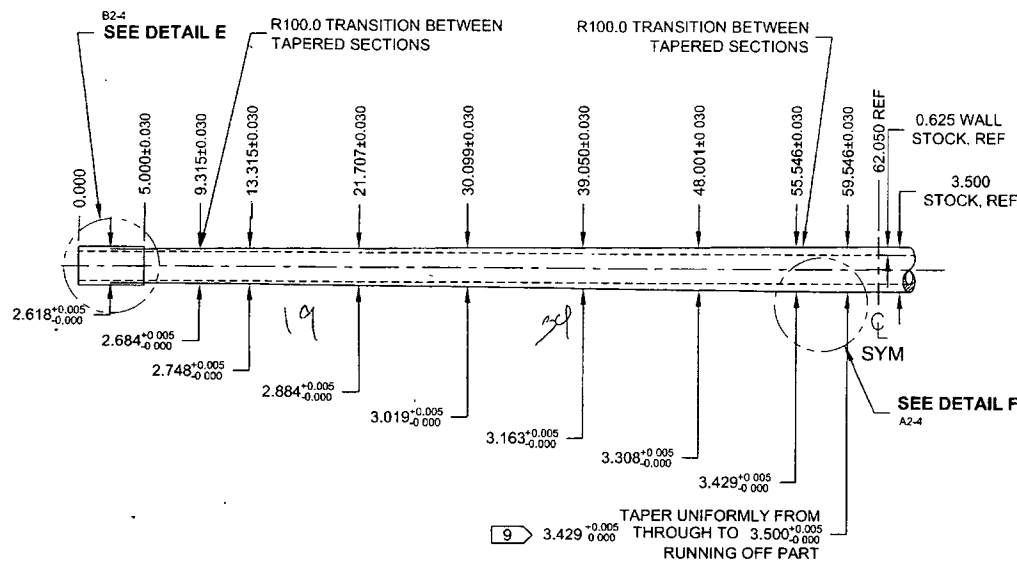


DETAIL E:
CROSSTUBE CUFF 08-4
SCALE 5X

D412-664-243TRN
TURNING DETAIL

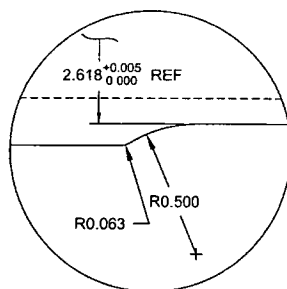

DETAIL G:
CUFF TRANSITION C2-4
SCALE 10X

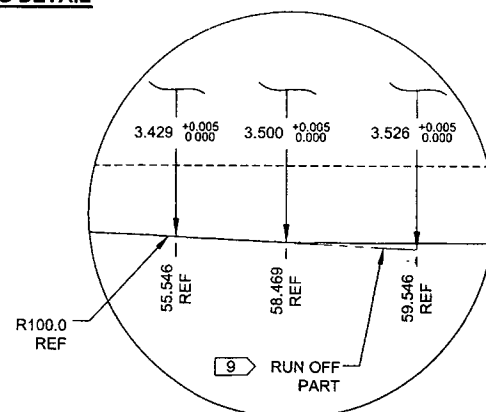

DETAIL F:
TAPER RUN-OFF C4-4
NOT TO SCALE

2 DEO ATTACHED

RELEASED
2009-10-29

DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	97	DRAWING NO.	REV. E
MFG. APPR.	11	D412-664-243	SHEET 4 OF 4
APPROVED	11	TITLE	SCALE
DE APPR.	11	CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	09.09.30	COPYRIGHT © 2001 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD			

DRAWING NO. D412-664-243	TITLE CROSSTUBE ASSEMBLY (412 HI AFT)	REV. E	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D412-664-243-E-1	SHEET NO. SHEET 1 OF 2	SCALE NTS
DRAWN	CHECKED	MFG. APPR.	APPROVED	DE APPR.			
DATE 11.03.31	DATE 11/03/31	DATE 11.03.31	DATE 11/03/31	DATE 11-03-31			

PURPOSE:

REMOVED ABRASION STRIP IN FAVOR OF A THIN LAYER OF PROSEAL 890.

CHANGE:

PARTS LIST IS AMENDED AS FOLLOWS:

IS:

Item	Qty -243	Part Number	Description
6	0	D2856-600-1009	ABRASION STRIP

WAS:

6	2	D2856-600-1009	ABRASION STRIP
---	---	----------------	----------------

NOTES 2 AND 14, SHEET 1 ARE AMENDED AS FOLLOWS:

IS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
MASK UNDERSIDE OF CROSSTUBE AS SHOWN (HATCHED AREA)
PAINT OUTSIDE PER DART QSI 005 4.2
AFTER PAINTING, APPLY CLEAR COAT ON HATCHED AREA
- 14) APPLY A THIN COAT OF PROSEAL 890 ON INSIDE CONCAVE SURFACE OF D3189-1
CHAFING SHIELD AND LET CURE PER MANUFACTURER'S INSTRUCTIONS. INSTALL
PROSEALED D3189-1 CHAFING SHIELD ONTO CROSSTUBE BY APPLYING A THIN COAT OF
PROSEAL 890 ONTO CROSSTUBE. BE SURE TO ELIMINATE ANY AIR GAPS.

WAS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 14) INSTALL D2856-600-1009 ABRASION STRIPS WITH A 0.13 REF GAP ON BOTTOM SIDE OF
CROSSTUBE PER QSI 035.

RELEASED
2011-04-07

DRAWING NO. D412-664-243	TITLE CROSSTUBE ASSEMBLY (412 HI AFT)	REV. E	DART AEROSPACE LTD ENGINEERING ORDER	D.E.O. NO. D412-664-243-E-1	SHEET NO. SHEET 2 OF 2	SCALE NTS
DRAWN	CHECKED	MFG. APPR.	APPROVED	DE APPR.		
DATE 11.03.31	DATE 11.03.31	DATE 11.03.31	DATE 11.03.31	DATE 11.03.31		

IS:

D3189-1 CHAFING SHIELD (1, INSTALLED OVER PROSEAL 890)
MS21920-28 CLAMP, 2X
2 PL

D412-664-603
BENT TUBE

2.00
1.00

WAS:

D2856-600-1009 ABRASION STRIP
D3189-1 CHAFING SHIELD (1, INSTALLED OVER ABRASION STRIP)
MS21920-28 CLAMP, 2X
2 PL

D3189-1
REF

**D412-664-243
ASSEMBLY DETAIL**

RELEASED
2011-04-07
MD

2
MASK AREA PRIOR TO PAINTING AND
APPLY CLEAR COAT AFTER PAINTING

2.00

Q
SYM

COPYRIGHT © 2011 BY DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT
WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DRAWING NO. D412-664-243	TITLE CROSSTUBE ASS'Y (412 HI AFT)	REV. E	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D412-664-243-E-2	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN <i>MP</i>	CHECKED <i>ASS</i>	MFG. APPR. <i>RE</i>	APPROVED <i>MP</i>		DE APPR. <i>MP</i>		
DATE 11.09.07	DATE 11.09.19	DATE 11.09.19	DATE 11.09.19		DATE 11.09.19		

PURPOSE:

REPLACE MAGNOBOND WITH 3M DP460 SCOTCH-WELD EPOXY ADHESIVE

05988

CHANGE:

IS:

Item	Qty -243	Part Number	Description
9	A/R	SCOTCH-WELD DP460	EPOXY ADHESIVE, 3M SCOTCH-WELD

WAS:

9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
---	-----	----------------	---

NOTE 12 & 16, SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 12) INSTALL D2896-1 CENTER SUPPORT USING A 0.04" TO 0.07" THICK LAYER OF SCOTCH-WELD DP460 PER QSI 015. LET CURE FOR 24 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 16) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. **PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER ADHESIVE HAS CURED FOR 24 HOURS.**

WAS:

- 12) INSTALL D2896-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2896-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 16) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

RELEASED
2011-09-29
MP

